



**Airworthiness
Directive
D-2004-443**

Luftfahrt-Bundesamt
Airworthiness Directive Section
Hermann-Blenk-Str. 26
38108 Braunschweig
Federal Republic of Germany

Stemme

Effective Date: September 27, 2004

Affected:

FAA - 2004-24641-6

Kind of aeronautical product:

Powered Sailplane

Manufacturer:

Stemme, Strausberg, Germany

Type:

Stemme S 10

Models affected:

all

Serial numbers affected:

a)

✓ S10-V

- S/N: 14-004 up to 14-030

✓ S10-VT

- S/N: 11-001 up to 11-089

b)

✓ S10

- S/N: 10-03 up to 10-56

✓ S10-V

- S/N: 14-001 up to 14-030 and all converted versions 14-003M up to 14-056M

✓ S10-VT

- S/N: 11-001 up to 11-089

German Type Certificate No.:

846

Subject: Flight Controls – Aileron control system / loose bearings

Reason:

A control lever with a loose bearing was found during the production of the powered sailplane S10. The following inspection of other levers has shown that a bearing may become loose during the operation of the powered sailplane.

Except for one connection, all the other connections between push-rods and levers are held in a fork-design that does not allow the joints to disengage due to a loose bearings. It is normally possible to find a slack bearing during the scheduled maintenance of the aircraft. A typical indication for a slack bearing is that it sticks out of its supporting lever.

The only joint which may completely disengage due to a loose bearing is the connection between the aileron control rod 10SQ-RMB and the connecting shaft 10SQ-RMW.

Action:

a. Inspection of the joint between the aileron control rod 10SQ-RMB and the connecting shaft 10SQ-RMW.

b. Inspection of all control system joints with circular caulked hinge or ball bearings

Inspection of existence / if necessary installation of Safety washer in the aileron system.

The Actions must be done in accordance with the instructions given in the mentioned Service Bulletin.

Compliance:

Action a: During every daily inspection until Action b has been done.

Action b: During the next scheduled maintenance action, but not later than December 31, 2004.

Technical publication of the manufacturer:

STEMME Service Bulletin No. A31-10-069 Amendment Index 01.a dated September 10, 2004 which becomes herewith part of this AD and may be obtained from Messrs.:

STEMME AG
Flugplatzstraße F 2, Nr. 7
D-15344 Strausberg
Federal Republic of Germany
Tel.: + 49.33 41 / 36 12 - 0 Fax: + 49.33 41 / 36 12 - 30
Mail: P.Ellwanger@stemme.de

Holders of affected aircraft registered in Germany have to observe the following:

Action has to be accomplished by the owner of the aircraft or an approved service station and to be checked and entered in the log book by a licensed inspector.

As a result of the a.m. deficiencies, the airworthiness of the aircraft is affected to such an extent that after the expiry of the a.m. dates the aircraft may be operated only after proper accomplishment of the prescribed actions. In the interest of aviation safety outweighing the interest of the receiver in a postponement of the prescribed actions, the immediate compliance with this AD is to be directed.

An appeal to this notice may be raised within a period of one month following notification. Appeals are to be raised with the Luftfahrt-Bundesamt, Hermann-Blenk-Str. 26, 38108 Braunschweig, in writing or for the purpose of drawing up minutes.

EASA-Approval

Approved by EASA under Approval-No. 2004-9942 on September 27, 2004.